
300XAC Series (@ CROHS)

Modular AC Power Sources

Our 300XAC Series modular AC power sources incorporate the latest in modular technology, making them ideal for the most demanding applications. These versatile AC power sources can be configured for 1Ø stand-alone operation or linked together for up to 16.2 kVA of AC power in 1Ø or up to 18 kVA of AC power in 3Ø output configurations.

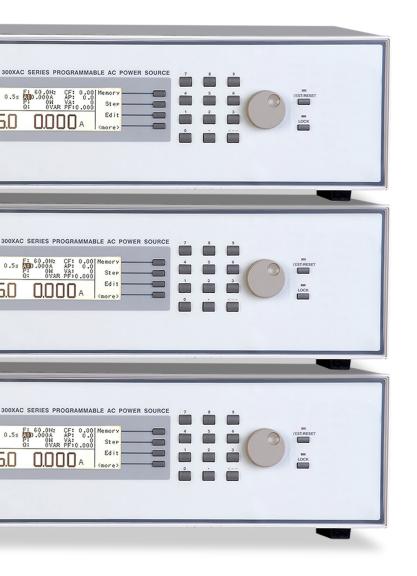

Features

- Modular design allows operator to connect up to 3 instruments together for 1Ø or 3Ø applications requiring up to 18kVA of AC power
- Configure 2 sources for 1Ø/2W output voltages up to 600VAC
- 50 built-in memory locations with 9 test steps
- Standard DC output capability
- Transient feature simulates voltage variations, brownouts, and transient voltage conditions
- Constant current output with over current fold back feature
- Rack mount handle kit included

Standard

USB/RS-232 Interface

Options

- Grounded Neutral
- Ethernet Interface
- GPIB Interface
- · Linking Card
- 7 Remote Memories





Applicable











APT Benefits





The Modular AC Source Advantage

What is a modular AC power source?

We use the term modular to define the capability of our 300XAC Series to be interconnected. The interconnection among up to three individual 300XAC Series Power Sources, allows for higher power outputs and different power configurations than an individual instrument could allow for Parallel or Polyphase modes.

What is Parallel mode?

Parallel mode allows the operator to increase the output current of the system by a factor of 2 or 3 depending on the number of sources that are interconnected.

What is Polyphase mode?

Polyphase mode allows the operator to increase the total power output of the system as well as change the output power configuration of the system.



Advantages

SmartDETECT

This exclusive feature automatically determines how many power sources are linked together. After the check is completed the 300XAC Series will automatically change the programming output function based on the number of linked sources.

SmartCONFIG Feature

This exclusive feature allows the operator to easily change the output of the linked sources to Parallel or Polyphase mode with the push of a button.

Master/Slave Relationship

The master/slave relationship between linked 300XAC instruments synchronizes the firmware of each power source so the output and phase angle separation is regulated. It also gives the operator the capability to program parameters for all linked sources from the front panel of the master instrument.

Exclusive Linking Card (option 08)

With the Linking Card option installed, up to three 300XAC instruments can be interconnected for Parallel or Polyphase output.

Benefits

- Easy to change from 1Ø to 3Ø output
- No need to have separate sources for 1Ø to 3Ø applications
- Allows for future expansion if power requirements change
- Greater mobility of the AC power sources
- Ability to generate 3Ø power if only 1Ø is available

Make Linking Your 300XAC A Breeze.

Download our Linking Guide at aptsources.com/300XAC

toll-free **+1-877-322-7693**

Specifications – 300XAC Series

INPUT		310XAC	320XAC	340XAC	360XAC		
Phase			1Ø		1Ø or 3Ø		
/oltage		100 - 240 VAC ±10%		200 - 240 VAC ±10%	1Ø: 200 - 240 VAC ±10% 3Ø3W: 200 - 240 VAC ±10% 3Ø4W: 346 - 416 VAC ±10%		
Frequency				47 - 63 Hz			
OUTPUT							
Voltage				5 - 300 V			
Max Power		1 kVA	2 kVA	4 kVA 6 kVA			
Max Current 1Ø	0 - 150 V	9.2 A @ ≤110 V	18.4 A @ ≤110 V	36.8 A @ ≤110 V	55.2 A @ ≤110 V		
	0 - 300 V	4.6 A @ ≤220 V	9.2 A @ ≤220 V	18.4 A @ ≤220 V	27.6A @ ≤220 V		
hase			•	ase Linking for 1Ø3W or 3Ø4W)			
requency		40.0 - 1000 Hz					
THD				(Resistive Load)			
Crest Factor			Inrush CF ≥3 at 110 V,	Continuous Current CF ≥3 at 110 V			
ine Regulation oad Regulation				± 0.1 V ± 0.5 V			
	TAGE			± 0.5 γ			
OC OUTPUT VOL	TAGE			5 - 420 V			
/oltage //ax Power		1000 W	2000 W	4000 W	6000 W		
Max Power Max Current 1Ø	0 - 210 V	4.8 A	9.6 A	19.2 A	28.8 A		
Canent ip	0 - 420 V	2.4 A	4.8 A	9.6 A	14.4 A		
Ripple & Noise (Pea		<3.			<4.0 V		
MEASUREMENT							
_	Range			0.0 - 400.0 V			
oltage/	Accuracy	± (1% of reading + 2 counts) >5 V ± (1% of reading + 5 counts) >5 V					
	Range			0.0 - 1000 Hz			
requency	Accuracy			.1 Hz, 501 - 1000 Hz ± 0.2 Hz			
	Range	0.005 A - 13.00 A	0.005 A - 26.00 A	0.05 A - 52.00 A	0.05 A - 78.00 A		
Current (RMS)	Accuracy	± (1% of readin	ng + 5 counts)	± (1% of reading + 5 counts) @ 40 - 100 Hz, ± (1% of reading + 5 counts) @ 101 - 500 Hz >0.1 A, ± (1% of reading + 5 counts) @ 501 - 1000 Hz >0.2			
	Range	0.0 A - 38.0 A	0.0 A - 76.0 A	0.0 A - 152 A	0.0 A - 228 A		
Current Peak	Accuracy		± (1% of	reading + 5 counts)			
	Range	0.0 W - 1300 W	0.0 W - 2600 W	0.0 W - 5200 W			
Power	L	± (2% of reading + 1	5 counts) at PF ≥0.2	± (2% of reading	g + 5 counts) at PF ≥0.2		
	Accuracy	<u> </u>	± (2% of reading + 5 counts) at + ≥0.2				
Power	Range	0.0 VA - 1300 VA	0.0 VA - 2600 VA	0.0 VA - 5200 VA	0.0 VA - 7800 VA		
Apparent (VA)	Calculated Formula	0.0 V/\ 1500 V/\			0.0 77 7000 77		
		0.01/40. 12001/40		Calculated value	0.01/AD 70001/AD		
ower Reactive (Q)	Range	0.0 VAR - 1300 VAR					
	Calculated Formula			-(W)², Calculated value			
Power Factor	Range	0.000 - 1.000					
	Calculated Formula	W/VA, Calculated and displayed to three significant digits					
Crest Factor	Range			0.0 - 10.0			
	Accuracy		A peak / Arms, Calculated	and displayed to two significant digits			
OPTIONS							
Grounded Neutral	Option 2			All Models			
GPIB Interface Option 3		All Models					
7 Remote Memory Option 4		All Models					
Ethernet Interface Option 6		All Models					
inking Card	Option 8			All Models			
GENERAL							
Operation Environr	ment		0 - 40	0°C / 20 - 80% RH			
Dimensions (W x H	x D)	16.92 x 5.26 x 20.87 in	16.92 x 5.26 x 20.87 in	16.92 x 10.51 x 19.69 in	16.92 x 15.77 x 19.69 in		
		430 x 133.5 x 530 mm	430 x 133.5 x 530 mm	430 x 267 x 500 mm	430 x 400.5 x 500 mm		
Net Weight		47.16 lbs (21 kg)	49 lbs (22 kg)	82 lbs (37 kg)	117 lbs (53 kg)		

Specifications - 300XAC Series

Linking Parallel	Output 19	02W	310XAC	320XAC	340XAC	360XAC	
Linked Unit				2 - 3 Uni	ts, 1Ø2W (L1 - N)		
Voltage	Phase				5 - 300 V		
Power Max	#11-:	2	1.8 kVA	3.6 kVA	7.2 kVA	10.8 kVA	
	# Units	3	2.7 kVA	5.4 kVA	10.8 K 10.8 kVAA A	16.2 kVA	
Max Current	0 - 150 V	L(2)	14.72 A @ 20 V -110 V	29.44 A @ 20 V -110 V	58.88 A @ 20V - 110 V	88.32 A @ 20 V - 110 V	
		L(3)	22.08 A @ 20 V - 110 V	44.16 A @ 20 V - 110 V	88.32 A @ 20 V - 110 V	132.48 A @ 20 V - 110 V	
Line (RMS)	0 - 300 V	H(2)	7.36 A @ 20 V - 220 V	14.72 A @ 20 V - 220 V	29.44 A @ 20 V - 220 V	44.16 A @ 20 V - 220 V	
		H(3)	11.04 A @ 20 V - 220 V	22.08 A @ 20 V - 220 V	44.16 A @ 20 V - 220 V	66.24 A @ 20 V - 220 V	
Linking Polyphas	e Output	1Ø3W	310XAC	320XAC	340XAC	360XAC	
Linked Units				2 Units @ 18	30°, 1Ø3W (L1-L2 - N)		
Voltage	Phase			1	0 - 600 V		
	Line		5 - 300 V				
Power	Max		2 kVA	4 kVA	8 kVA	12 kVA	
Max Current Phase	0 - 300 V	L(1)	9.2 A @ ≤110 V	18.4 A @ ≤110 V	36.8 A @ ≤110 V	55.2 A @ ≤110 V	
	0 - 600 V	H(1)	4.6 A @ ≤220 V	9.2 A @ ≤220 V	18.4 A @ ≤220 V	27.6 A @ ≤220 V	
Max Current Line	0 - 300 V	L(2)	9.2 A @ ≤220 V	18.4 A @ ≤220 V	36.8 A @ ≤220 V	55.2 A @ ≤220 V	
	0 - 600 V	H(2)	4.6 A @ ≤440 V	9.2 A @ ≤440 V	18.4 A @ ≤440 V	27.6 A @ ≤440 V	
Linking Polyphas	e Output	3Ø4W	310XAC	320XAC	340XAC	360XAC	
Linked Units		3 Units @ 120°, 3Ø4W (L1-L2-L3 - N)					
Voltage	Phase		5-300 V				
	Line		5 - 520 V				
Power	Max		3 kVA	6 kVA	12 kVA	18 kVA	
Max Current Phase	0 - 150 V	L(1)	9.2 A @ ≤110 V	18.4 A @ ≤110 V	36.8 A @ ≤110 V	55.2 A @ ≤110 V	
	0 - 300 V	H(1)	4.6 A @ ≤220 V	9.2 A @ ≤220 V	18.4 A @ ≤220 V	27.6 A @ ≤220 V	
Max Current Line	0 - 150 V	L(3)	9.2 A @ ≤190.5 V	18.4 A @ ≤190.5 V	36.8 A @ ≤190.5 V	55.2 A @ ≤190.5 V	
	0 - 300 V	H(3)	4.6 A @ ≤381 V	9.2 A @ ≤381 V	18.4 A @ ≤381 V	27.6 A @ ≤381 V	
Max Current Phase Delta	0 - 260 V	L(3)	5.31 A @ ≤190.5 V	10.62 A @ ≤190.5 V	21.24 A @ ≤190.5 V	31.87 A @ ≤190.5 V	
	0 - 520 V	H(3)	2.65 A @ ≤381 V	5.31 A @ ≤381 V	10.62 A @ ≤381 V	15.93 A @ ≤381 V	
Linking Parallel D	C Output	1Ø2W	310XAC	320XAC	340XAC	360XAC	
Linked Units					ts, 1Ø2W (L1 - N)		
Voltage Power	Line				5 - 420 V		
Power Max	# Units	2	1.8 kVA	3.6 kVA	7.2 kVA	10.8 kVA	
		3	2.7 kVA	5.4 kVA	10.8 kVA	16.2 kVA	
Max Current	0 - 210 V	L(2)	7.68 A @ 50 V - 210 V	15.36 A @ 50 V - 210 V	30.72 A @ 50 V - 210 V	46.08 A @ 50 V - 210 V	
Line		L(3)	11.52 A @ 50 V - 210 V	23.04 A @ 50 V - 210 V	46.08 A @ 50 V - 210 V	69.12 A @ 50 V - 210 V	
	0 - 420 V	H(2)	3.84 A @ 50 V - 420 V	7.68 A @ 50 V - 420 V	15.36 A @ 50 V - 420 V	23.04 A @ 50 V - 420 V	
		H(3)	5.76 A @ 50 V - 420 V	11.52 A @ 50 V - 420 V	23.04 A @ 50 V - 420 V	34.56 A @ 50 V - 420 V	

toll-free +1-877-322-7693

Specifications – 300XAC Series

Measurement (To Linking Parallel 1	Linking Parallel 1Ø2W		310XAC	320XAC	340XAC	360XAC		
oltage Range				0.0) - 400.0 V			
	Accuracy		\pm (1% of reading + 2 counts) >5 V \pm (1% of reading + 5 counts) >5 V					
Frequency	Range		0.0 - 1000.0 Hz					
	Accuracy L		± 0.1 Hz @ 0.0 - 500 Hz					
			± 0.2 Hz @ 501 - 1000 Hz					
Current (RMS)	Range	2	0.00 A - 26.00 A	0.00 A - 52.00 A	0.00 A - 104.0 A	0.00 A - 156.0 A		
		3	0.00 A - 39.00 A	0.00 A - 78.00 A	0.00 A - 156.0 A	0.00 A - 234.0 A		
	Accuracy L		± (1.5% of reading +15 counts) x # of Linked Units @ 40.0 - 70.0 Hz & Current is >1.0 A		± (1.5% of reading +15 counts) x Link Units @ 40.0 - 70.0 Hz and Current (RMS) >2.00 A, ± (1.5%	± (1.5% of reading +15 counts) x Link Units @ 40.0 - 70.0 Hz and Current (RMS) >3.00 A,		
		Н		ounts) x # of Linked Units Current is >5.00 A	of reading +15 counts) x Link Units @ 70.1 - 1000 Hz, and Current (RMS) >10.00 A	± (1.5% of reading +15 counts) x Link Units @ 70.1 - 1000 Hz, and Current (RMS) >15.00 A		
Power (W)	Range	2	0 W - 2600 W	0 W - 5200 W	0 W -10400 W	0 W - 15600 W		
		3	0 W - 3900 W	0 W - 7800 W	0 W - 15600 W	0 W - 23400 W		
	Accuracy		\pm (2% of reading + 10 counts) x (# of Linked Units) at PF ≥0.2, 40 - 500 Hz, and Current >5.0 A \pm (2% of reading + 10 counts) x (# of Linked Units) at PF ≥0.3, 501 - 1000 Hz, and Current >5.0 A					
Power Apparent	Range	2	0 W - 2600 VA	0 W - 5200 VA	0 W -10400 VA	0 W - 15600 VA		
(VA)		3	0 W - 3900 VA	0 W - 7800 VA	0 W - 15600 VA	0 W - 23400 VA		
	Accuracy		V x A, Calculated Value					
Power Reactive (Q)	Range	2	0 W - 2600 VA	0 W - 5200 VA	0 W -10400 VA	0 W - 15600 VA		
		3	0 W - 3900 VA	0 W - 7800 VA	0 W - 15600 VA	0 W - 23400 VA		
	Accuracy		$\sqrt{(VA)^2 - (W)^2}$, Calculated Value					
Power Factor	Range		0 - 1.000					
	Accuracy		W / VA, Calculated and displayed to three significant digits					
Measurement (To Linking Polyphas			310XAC	320XAC	340XAC	360XAC		
Voltage	Range	2		ge + L2 Voltage				
	Accuracy		Summation of linked sources, Calculated and displayed to one significant digit					
Frequency	Range		0.0 - 1000.0 Hz					
	Accuracy	L	± 0.1 Hz @ 0.0 - 500 Hz					
		Н	± 0.2 Hz @ 501 - 1000 Hz					
Current (RMS)	Range	2	(L1 Current + L2 Current)/2					
Accuracy $\pm (1\% \text{ of reading} + 5 \text{ counts}) \text{ at } 40 - 70 \text{ Hz}$ $\pm (1\% \text{ of reading} + 5 \text{ counts}) \text{ at } 70.1 - 500 \text{ Hz}, \text{ and output current (RMS)} > 0.20$ $\pm (1\% \text{ of reading} + 5 \text{ counts}) \text{ at } 501 - 1000 \text{ Hz}, \text{ and output current (RMS)} > 0.30$								
Power (W)	Range	2	L1 Power + L2 Power					
	Accuracy	2	L1 Power + L2 Power, Calculated Value					
Power Apparent	Range	2	L1 VA + L2 VA					
(VA)	Accuracy	2						
Power Reactive (Q)	Range	2	L1 VAR + L2 VAR					
	Accuracy	2	L1 VAR + L2 VAR, Calculated Value					
Power Factor	Range			0) - 1.000			
	Accuracy		(L1	P + L2 P) / (L1 VA + L2 VA), Calcula	ted and displayed to three significant dig	its		

Specifications - 300XAC Series

Measurement (Total) Linking Polyphase 3Ø4W		310XAC	320XAC	340XAC		360XAC	
Voltage	Range		(A+B+C)/3				
Accuracy		(A+B+C)/3, Calculated and displayed to one significant digit					
Frequency	Range		0.0 - 1000.0 Hz				
	Accuracy L		± 0.1 Hz @ 0.0 - 500 Hz				
			± 0.2 Hz @ 501 - 1000 Hz				
Current (RMS)	Range		(A+B+C)/3				
	Accuracy		\pm (1% of reading + 5 counts) at 40 - 70 Hz \pm (1% of reading + 5 counts) at 70.1 - 500 Hz, and output current (RMS) > 0.200 A \pm (1% of reading + 5 counts) at 501 - 1000 Hz, and output current (RMS) > 0.300 A				
Power (W)	Range		A Power + B Power + C Power				
	Accuracy		Calculated Value				
Power Apparent	Range		A VA + B VA + C VA				
(VA)	Accuracy		Calculated Value				
Power Reactive (Q)	Range		A VAR + B VAR + C VAR				
	Accuracy		Calculated Value				
Power Factor	Range		0 - 1.000				
	Accuracy		Sum P / Sum VA, Calculated and displayed to three significant digits				
Measurement (Total) Linking Parallel DC		310XAC	320XAC 340XAC			360XAC	
Voltage	Range			0.0 - 420.0 V			
	Accuracy		\pm (1% of reading + 2 counts) >5 V \pm (1% of		of reading + 5 counts) >5 V		
Current (RMS)	Range	2	0.05 A - 26.00 A	0.05 A - 52.00 A	0.05 A - 104.00 A		0.05 A - 156.00 A
		3	0.05 A - 39.00 A	0.05 A - 78.00 A	0.05 A - 156.00 A		0.05 A - 234.00 A
	Accuracy		± (1% of reading + 5 counts) x # of Linked Units, Current >1.00 A		± (1% of reading + 5 counts) x # of Linked Units, Current >2.00 A	± (1% of	reading + 5 counts) x # of Linked Units, Current >3.00 A
Power (W)	Range	2	0 W - 2600 W	0 W - 25200 W	0 W -10400 W		0 W - 15600 W
		3	0 W - 3900 W	0 W - 7800 W	0 W - 15600 W		0 W - 23400 W
	Accuracy		'	± (2% of reading + 5 counts) x # of Linked Units			

Specifications subject to change

Why We Use Counts

APT publishes some specifications using "counts" which allows us to provide a better indication of the tester's capabilities across measurement ranges. A count refers to the lowest resolution of the display for a given measurement range. For example, if the resolution for voltage is 1V then 2 counts = 2V.

Key $L = Low Limit Range$ $L (2) = Low Limit Range 2 Units Linked$ $H (2) = High Limit Range 2 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$ $L (3) = Low Limit Range 3 Units Linked$
--